

PORTLAND**ELEV 266****AVFAX CODE 3013**

VIC

UTC +10

YPOD

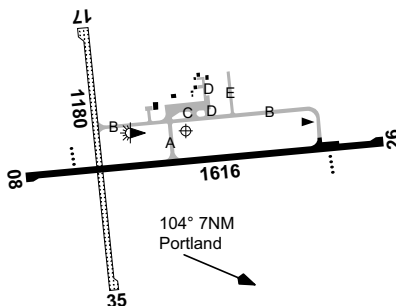
381905S

1412816E

VAR 10 DEG E

CERT

AD OPR Glenelg Shire Council, PO Box 152, Portland, VIC, 3305. PH 0427 360 578 H24. Council
PH 03 5522 2200. Fax Council 03 5522 2290.

**REMARKS**

AD Charges: All commercial ACFT.

HANDLING SERVICES AND FACILITIES

Portland Aero Club: AVGAS H24 self-service bowser. V and MC. Phone 0417 163 324.

Glenelg Shire Council: JET A1 H24 self-service bowser. V and MC. Phone 0427 360 578.

APRONS AND TAXIWAYS

1. TWY A, TWY B (FM TWY A to TWY C) and TWY C, sealed, unrated.
2. TWY D and TWY E, sealed MAX 5,700KG.
3. TWY B west of TWY A and east of TWY E, grassed MAX 5,700KG.

METEOROLOGICAL INFORMATION PROVIDED

1. TAF CAT D, METAR/SPECI.
2. AWIS PH 03 8470 3204 - Report faults to BoM.
3. AWIS FREQ 118.75 - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

08/26	077	53a	PCR 90/F/B/0.87 MPa/U	WID 30	RWS 150
17/35	167	39c	5700 kg/0.55 MPa Natural Surface. Central	WID 30	RWS 90
			23M Gravel		

AERODROME AND APPROACH LIGHTING

RWY 08/26	LIRL	AFRU+PAL 127.95	SDBY PWR AVBL
RWY 08/26	PAPI(1)	AFRU+PAL 127.95	SDBY PWR AVBL

(1) Left side.

1. RWY edge light spacing: 08/26: 60M.
2. HJ selection of PAL will only activate PAPI. RWY lights will only OPR when poor light levels exist.
3. PAL 30 MIN cycle, 10 MIN warning.

OTHER LIGHTING

1. Secondary PWR switchover time: 20 SEC.
2. TWY A, TWY B (from TWY A to TWY C) and TWY C Green CL.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA	MELBOURNE CENTRE	125.8 Circuit Area
-----	------------------	--------------------

CTAF - AFRU 127.95**ADDITIONAL INFORMATION**

Bird and animal hazard exists.

CHARTS RELATED TO THE AERODROME

1. WAC 3469.
 2. Also refer to AIP Departure and Approach Procedures.
-