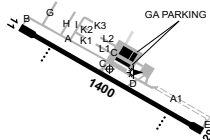


SCONE**ELEV 745****AVFAX CODE 2023**

NSW

320214S

1504956E

UTC +10

VAR 12 DEG E

YSCO

CERT

AD OPR Upper Hunter Shire Council, PO Box 208, Scone, NSW, 2337.

PH 02 6540 1100: AH AD Manager 0439 428 134. Fax 02 6545 2671.

REMARKS

- AD Charges: Refer to <http://upperhunter.nsw.gov.au/> for current fees and charges. Bookings for ACFT PRKG is compulsory over 5,700KG.
- Gate access code from landside to main apron is: C then the YSCO CTAF.

HANDLING SERVICES AND FACILITIES

Aero Refuellers - AVGAS and JET A1 H24 self-service bowsers. Accept Aero Refuellers cards, V and MC. PH: 0413 003 808.

PASSENGER FACILITIES

Terminal facilities AVBL in Scone Memorial Airport BLDG. Access code is C then YSCO CTAF. RF (cafe WED-FRI: 0800-1500, SAT/SUN: 0900-1500 Local).

AERODROME OBSTACLES

Trees:

- 748FT AMSL PSN 320233.88S 1505031.55E. Infringes OLS by 5FT.
- 745FT AMSL PSN 320234.02S 1505031.84E. Infringes OLS by 1FT.
- 773FT AMSL PSN 320221.58S 1505013.00E. Infringes TNS by 4FT.
- 757FT AMSL PSN 320221.74S 1505011.27E. Infringes TNS by 4FT.
- 755FT AMSL PSN 320222.78S 1505013.29E. Infringes TNS by 3FT.
- 751FT AMSL PSN 320223.95S 1505015.44E. Infringes TNS by 5FT.

METEOROLOGICAL INFORMATION PROVIDED

- TAF CAT D, METAR/SPECI.
- AWIS PH 02 9353 6449 - Report faults to BoM.
- AWIS FREQ 134.55 (requires 1 second pulse to activate) - Report faults to AD OPR.

PHYSICAL CHARACTERISTICS

11/29 110 46 PCR 240/F/D/X/T Uneven SFC due to soil WID 30 RWS 90
movement

RWS not AVBL due rough SFC.

AERODROME AND APPROACH LIGHTING

RWY 11/29	LIRL(1)	PAL 128.0	
RWY 11	PAPI(2)	PAL 128.0	3.0 DEG45FT
RWY 29	PAPI(3)	PAL 128.0	3.0 DEG46FT

- PAL requires three one-second pulses to activate.
- Right side. PAL requires three one-second pulses to activate.
- Left side. PAL requires three one-second pulses to activate.

OTHER LIGHTING

TWY LGT: Blue edge on TWY C.

ATS AND AERODROME COMMUNICATION FACILITIES

FIA BRISBANE CENTRE 124.8 4000FT

LOCAL TRAFFIC REGULATIONS

- Exit TWY at the RWY 11 end is 7.5M wide.
- Two gravel TWY to the fire bombing base is restricted to fire bombing ACFT only.
- Main TWY BTN 'Air Pasture' and hangars not AVBL due to uneven SFC.
- Helicopter parking AVBL on TWY A between TWY C and D.

CTAF 128.0

ADDITIONAL INFORMATION

1. Animal hazard (kangaroos, foxes and birds) exists WI VCY RWY 11/29.
2. Caution: The pilot in command should be aware of the terrain and obstacles in the circling area prior to conducting Night IFR OPS into Scone.
3. Caution: During rain, GA APN holds excessive water at entrance and near refuelling bowser.

CHARTS RELATED TO THE AERODROME

1. WAC 3456.
 2. Also refer to AIP Departure and Approach Procedures.
-